



Strain Gage Installations with Sauereisen-DKS-8 Cement

Introduction

Sauereisen-DKS-8 Cement is a single part off white powder when mixed with water forms a chemical bond. When properly cured has high electrical insulation values and good thermal conductivity. Its operating temperature range is – 452° F (-269° C) to +2500° F (+1370° C). It is capable of elongations of 0.5% strain.

Installation Accessories

For proper results, the procedures and techniques presented in this bulletin should be used with qualified Vishay Micro-Measurements installation accessory products. M-LINE accessories used in this procedure are:

- CSM Degreaser or GC-6 Isopropyl Alcohol
- Silicon Carbide Paper
- M-Prep Conditioner A
- M-Prep Neutralizer 5A
- GSP-1 Gauze Sponges
- CSP-1 Cotton Applicators
- MJG-2 Mylar Tape

Handling Precautions

While this material is considered relatively safe to handle, contact with skin and inhalation of vapors should be avoided. Immediate washing with ordinary soap and water is effective in cleansing should skin contact occur. For eye contact, rinse thoroughly with a copious amount of water and consult a physician. For additional health and safety information, consult the Material Safety Data Sheet which is available upon request.

Mixing Adhesive

Sauereisen-DKS-8 will cure at +75 deg F (+24 deg C) in 18-24 hours, with approximately 0.5% elongation capability.

The supplied powder should be mixed thoroughly before using. The powder is mixed at a ratio of 100 parts powder to 13 parts water. Place the powder into a clean mixing container. Add water all at one time while mixing – do not add water

gradually. Continue mixing until a smooth, uniform consistency is obtained. Mixing may be done with a slow speed mixer or by hand with a spatula. Do not use more water than the allowed mix ratio as this will reduce the mechanical strength, increases shrinkage, and delays curing time. Do not attempt to re-temper by adding more water.

The mixed pot life is approximately 30 minutes.

Getting Started

The installation procedure presented here is somewhat abbreviated and is intended only as a guide in achieving proper gage installation with Sauereisen-DKS-8 Cement. Vishay Micro-Measurements Instruction Bulletin B-129, "Surface Preparation for Strain Gage Bonding", presents recommended procedures for surface preparation, and lists specific considerations that are helpful when working with most common structural materials.

Step 1

The surface preparation technique used is the same basic cleaning procedure described in Vishay Micro-Measurements Instruction Bulletin B-129, "Surface Preparation for Strain Gage Bonding". The initial step is to thoroughly degrease with solvents such as CSM Degreaser or GC-6 Isopropyl Alcohol. CSM Degreaser is preferred whenever possible since this is a very active degreaser. The substitution of GC-6 as a degreasing agent should be considered for materials that may be sensitive to strong solvents.

Any degreasing should be done with clean solvents. Thus the use of a "one-way" container, such as the aerosol can, is highly advisable.

Step 2

Sandblast with course sand medium (As an alternate dry-abrade the gaging area with 220-grit silicon-carbide paper) to remove any scale or oxides on the base material.

With a 4H (hard) drafting pencil on aluminum or a ball-point pen on steel, burnish whatever alignment marks are needed on the specimen. Wet the surface with Conditioner A and scrub



Instruction Bulletin B-182

Vishay Micro-Measurements

with cotton-tipped applicators until a clean applicator is no longer discolored by the scrubbing. Remove the residue and Conditioner by slowly wiping through the gaging area with a gauze sponge. Do not wipe back and forth over the gage area since this may allow contaminants to be re-deposited on the cleaned area.

Step 3

Apply a liberal amount of M-Prep Neutralizer 5A to the gage area. Keeping the surface wet, scrub with cotton-tipped applicators. Do not allow evaporation of the cleaning material on the specimen surface since this would leave a thin, unwanted film between the adhesive and the specimen. Remove the Neutralizer by slowly wiping through the gage area, allowing the gauze sponge to absorb the Neutralizer. Do not wipe back and forth over the gage area since this may allow contaminants to be re-deposited on the cleaned area.

Step 4

Base Coat application – Thoroughly mix the Sauereisen-DKS-8 using a clean spatula or glass-stirring rod. The base coat consists of a layer of cement approximately 0.003 inches (0.08 mm) when the cement is wet and uncured. The thickness of the base coat is determined by using a layer of 0.003 inch thick MJG-2 Mylar tape, which is laid parallel to, and slightly overlapping, the roughened area. Note: If the surface the strain is to be installed on is only flat in one axis, such as a cylinder, the two layers of tape must be applied on the curved surface so that the spatula will be drawn along the flat axis. A strip of the MJG-2 mylar tape can be placed across each end of the gage area to limit the flow out of the cement. A liberal amount of the cement is applied to one end of the gage area. Spread the cement smoothly by slowly drawing the spatula across the gage area in one movement. Allow curing for 18-24 hours at room temperature. If an accelerated cure is desired place the part into a low temperature oven 180 °F or less (82° C). Avoid temperatures that might cause steaming, as this will degrade the performance of the cement.

Step 5

Gage Installation – The free filament foil gage is attached to a Mylar backing with strips of fiberglass tape. These gages are very thin and fragile. Using a razor blade, lift the tape from the Mylar backing so that the gage can be removed from the backing. Place the gage in position on the base coat using the fiberglass tape to hold it in place. Using a soft camels hair brush apply a coat of cement over the gage grid, being sure to cover the junction of the strain gage tab with the foil leads. Through wetting is obtained by wiggling the brush over the gage foil. Allow to air dry for 18-24 hours at room temperature. . If an accelerated cure is desired place the part into a low temperature oven 180 °F or less (82° C). Avoid temperatures that might cause steaming, as this will degrade the performance of the cement.


Step 6

Leadwire attachment – A high temperature wire suitable for high temperature and welding must be used for the leadwire. There are a number of wires that can be used:

- SS Sheath with a variety of leadwires (Ni-clad copper, Ni-clad silver, chromel, alumel, Nichrome)
- Nextel Insulated leadwires
- Ceramic coated leadwires

Put the unsized glass sleeving over leadwire on the end near the gage to keep the leadwire from shorting out.

Cut two lengths 2-1/2 inches (64 mm) of Nichrome V wire (1-KL-16-002) 1/16 x 0.002 inches (1.6 mm x 0.05 mm) and fold each in half. Spot weld three times, 0.25 inches (6 mm) from the folded end, then trim off the fold. (see sketch)

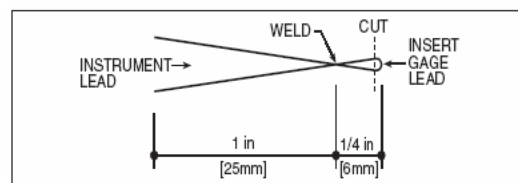

Insert gage lead between the 0.25 inch (6 mm) end of the transition ribbons, and spot weld the two layers of Nichrome at a minimum of three points.

Repeat for the second lead.

Strain Gage Installations with Sauereisen-DKS-8 Cement



Instruction Bulletin B-182

Vishay Micro-Measurements

Strip the insulation from the end of the leadwire and place this exposed wire between the two layers of Nichrome (which have not been welded) on the gage leads. For the three wire method, put both leads between the other Nichrome ribbon.

All exposed leads and ribbons should then be coated with Sauereisen-DKS-8.

Strain Gage Installations with Sauereisen-DKS-8 Cement

Document No.: 11391

Page 3 of 3

Revision 27-Jan-05